

OSAS + OSM = OVER STROKE ACTIVE SAFETY + OVER STROKE MARKER

Il nuovo codice sarà fornito solo ad esaurimento del vecchio
 The new code will be supplied only when the old will be out of stock
 Der neue Kode wird nur angegeben, wenn der alte nicht mehr lieferbar ist
 Le nouveau code sera fourni uniquement lorsque le vieux stock sera écoulé
 El nuevo código será suministrado sólo cuando se agoten las existencias del antiguo
 O novo código irá ser fornecido apenas quando o antigo esgotar stock

ACTIVE SAFETY



OSAS



USAS



OPAS





SKUDO

easu MANIFOLD p. 247

* F_{1i} = Isothermal end force at 100% Cu p. 16



** F_{1p} = Polytrophic end force at 100% Cu

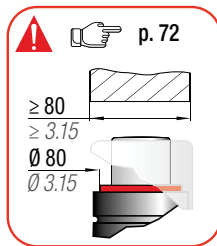

RS

N ₂		0 - 80 °C 32 - 176 °F	ΔP ± 0,33 %/°C	P max 150 bar 2175 psi	P min 20 bar 290 psi	S 28,27 cm ² 4.382 in ²	SPM ~ 20 - 100 (at 20°C)	Max Speed 1,8 m/s	Maintenance kit 39BMRV04200C
CODE	NEW	Cu	L	L min	F ₀	F _{1i} *	F _{1p} **	V ₀	
PHASING OUT from 04/2021		mm inch	mm inch	mm inch	Initial force daN lb	End force * daN lb	End force ** daN lb	cm ³ in ³	~Kg ~lb
RS 4200 - 013 - A	◆ RS 4200 - 013 - B	13 0.51	90 3.54	77 3.03	4240 9532 ± 5%	5651 12703	6498 14607	172 10.50	2,76 6.08
RS 4200 - 016 - A	◆ RS 4200 - 016 - B	16 0.63	96 3.78	80 3.15		5842 13133	6791 15267	192 11.72	2,83 6.24
RS 4200 - 022 - A	RS 4200 - 022 - B	22 0.87	108 4.25	86 3.39		6147 13819	7266 16334	232 14.16	2,98 6.57
RS 4200 - 029 - A	RS 4200 - 029 - B	29 1.14	122 4.80	93 3.66		6413 14417	7687 17280	279 17.03	3,16 6.97
RS 4200 - 035 - A	RS 4200 - 035 - B	35 1.38	134 5.28	99 3.90		6590 14815	7969 17915	320 19.53	3,30 7.28
RS 4200 - 047 - A	RS 4200 - 047 - B	47 1.85	158 6.22	111 4.37		6852 15403	8392 18866	401 24.47	3,60 7.94
RS 4200 - 060 - A	RS 4200 - 060 - B	60 2.36	184 7.24	124 4.88		7049 15848	8715 19593	488 29.78	3,93 8.66
RS 4200 - 072 - A	RS 4200 - 072 - B	72 2.83	208 8.19	136 5.35		7184 16149	8936 20089	569 34.72	4,20 9.26
RS 4200 - 077 - A	RS 4200 - 077 - B	77 3.03	218 8.58	141 5.55		7230 16254	9013 20262	603 36.80	4,35 9.59
RS 4200 - 097 - A	RS 4200 - 097 - B	97 3.82	258 10.16	161 6.34		7377 16583	9256 20809	737 44.97	4,85 10.69
RS 4200 - 122 - A	RS 4200 - 122 - B	122 4.80	308 12.13	186 7.32	7503 16867	9467 21283	906 55.29	5,47 12.06	

◆ Disposable

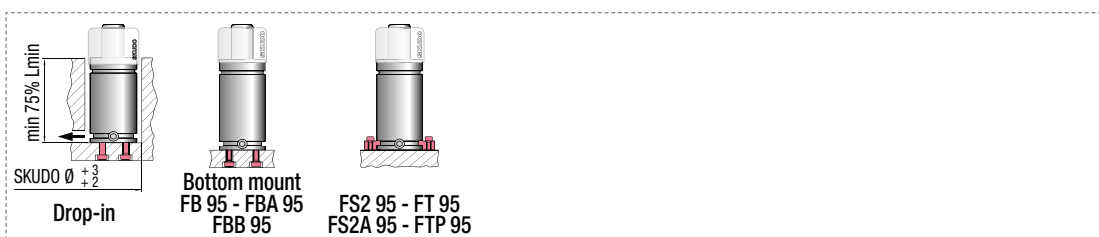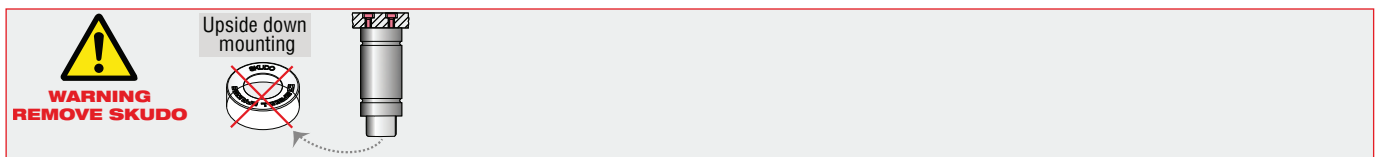

HOW TO ORDER p. 73
INSTALLATION GUIDELINE p. 205